
## Service Bulletin Nº 66

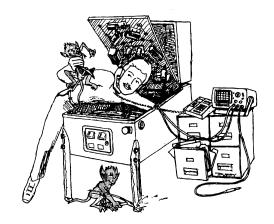

Data East Pinball, Inc. 1990 Janice Avenue Melrose Park, IL 60160 © 1-800-KICKERS or © 708-345-7700 Fax: 708-345-7889



## Technical Support

Joe Blackwell Director, Technical Support Eric Winston
Technical Support Engineer

Ted Kilpin Technical Support Engineer Jay Alfer Tech. Doc. Administrator

TO:

Parts & Service Managers

DATE:

November 2, 1994

RE:

TOMAY

The Who's Tommy New Ball Kicker Arm Assembly,

Part Number 515-6213-00

SYMPTOM —

The original Ball Kicker Arm Assembly, (PN 515-5991-00), used on the Shooter / Kicker Assembly, (PN 500-5797-00), has had a higher than normal failure rate. The *kick-arm* has been breaking off directly below the striking surface resulting in part orders.

PROBLEM —

The **Hollow Metal Sleeve** is breaking free from the *kick-arm brackets*, allowing them to twist, creating a stress point below the striking surface.

**SOLUTION** —

Replace with the **New Ball Kicker Arm Assembly**, PN 515-6213-00. Listed below are some of the improvements we have made (refer to the diagram on the next page):

- 1) The material has been changed from cold rolled steel to stainless steel.
- 2) The width of the material behind the nibble has been increased.
- The shape of the sleeve has been changed to a "**D**" shaped sleeve to prevent slippage.
- 4) The seam welding has been eliminated and replaced with spot welding to reduce hardening of the material.
- The circular hole has been changed to a "*teardrop*" hole on the striking surface to improve accuracy and reduce stress.

If you have any questions or experience any problems, please call our Technical Support Department.

